



PHILIPS

Important information to Dealer shops and Garages

Concerning Xenon D1S for SAAB 9-5 model year 2003-2010

During 2006 a problem with Xenon lamps was discovered concerning above mentioned car models . After approximately half of the lamp life time (1000 h – 1500 h) it starts to flicker and blink and within a short period of time the lamp will stop working . This issue is caused by the electronic system and ballast in the car and therefore cannot be deduced to the lamp itself.


To solve the issue and ensure a safe and secure ride, Saab has in cooperation with Philips developed a special Xenon lamp . This Xenon lamp can handle this particular electronic system in the car and will consequently last the full expected life time. The lamp has been available on the market for some time, however this information has not been recieved by dealers , garages or consumers.

- To be able to offer our end consumers a safe and reliable product **we recommend to always use the Philips lamp in all situations when changing lamps.**
- To ensure that the correct lamp is mounted in the car the 10 digit part number is printed on the bottom of the lamp. **9285.147.294**. See below.
- Philips is today the only supplier providing this special Xenon lamp.



This denotes the special Saab lamp. It is marked with147....

Below is the new packaging used since 2012-01-01

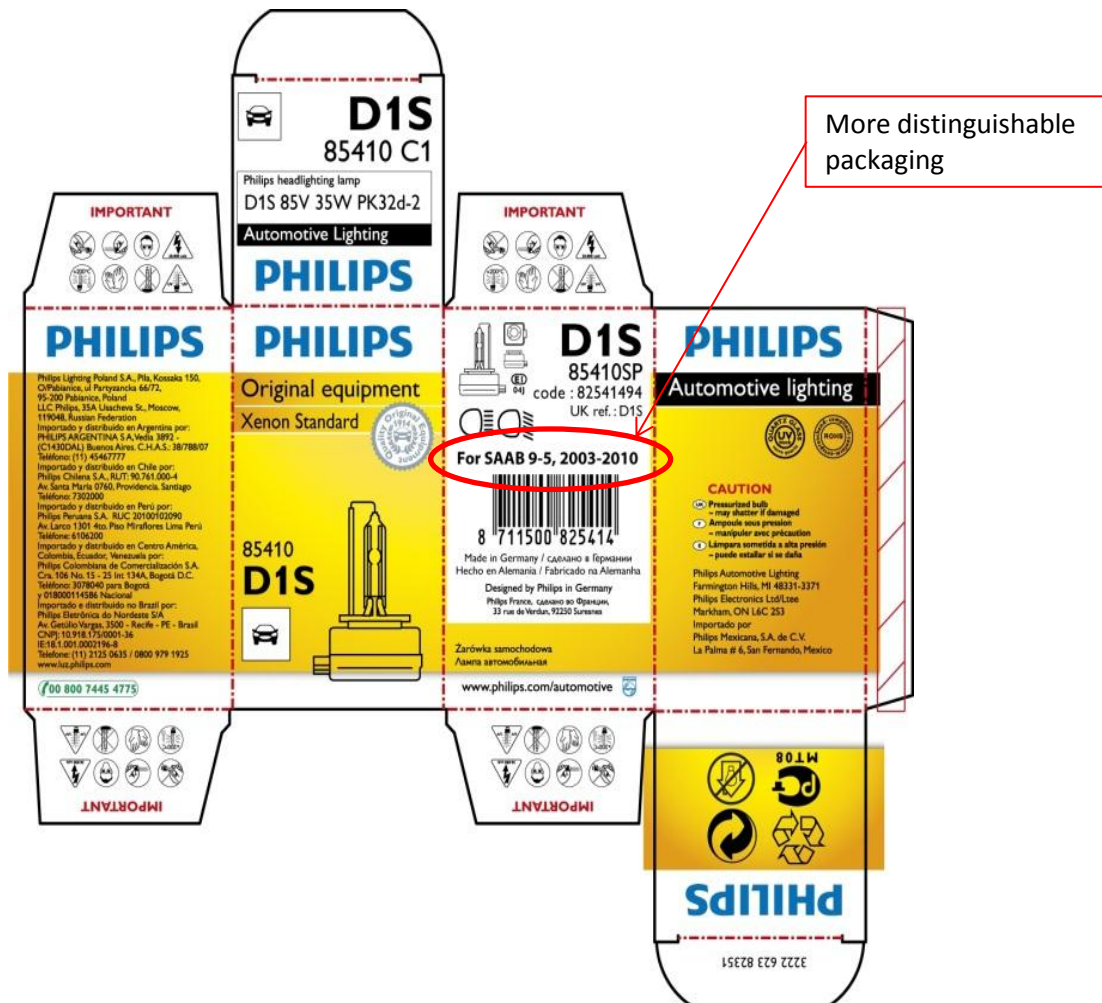

With kind regards:

SAAB Automobile Parts AB
611 45 Nyköping

For questions please contact:

Philips Automotive
Knarrarnäsgatan 7
185 64 Stockholm

Tel: +46-(0)8-5285 2000